


schepach

5903405901

oscillating edge-, belt-
and spindle sander
OSM600 schepach
(DIY)



A

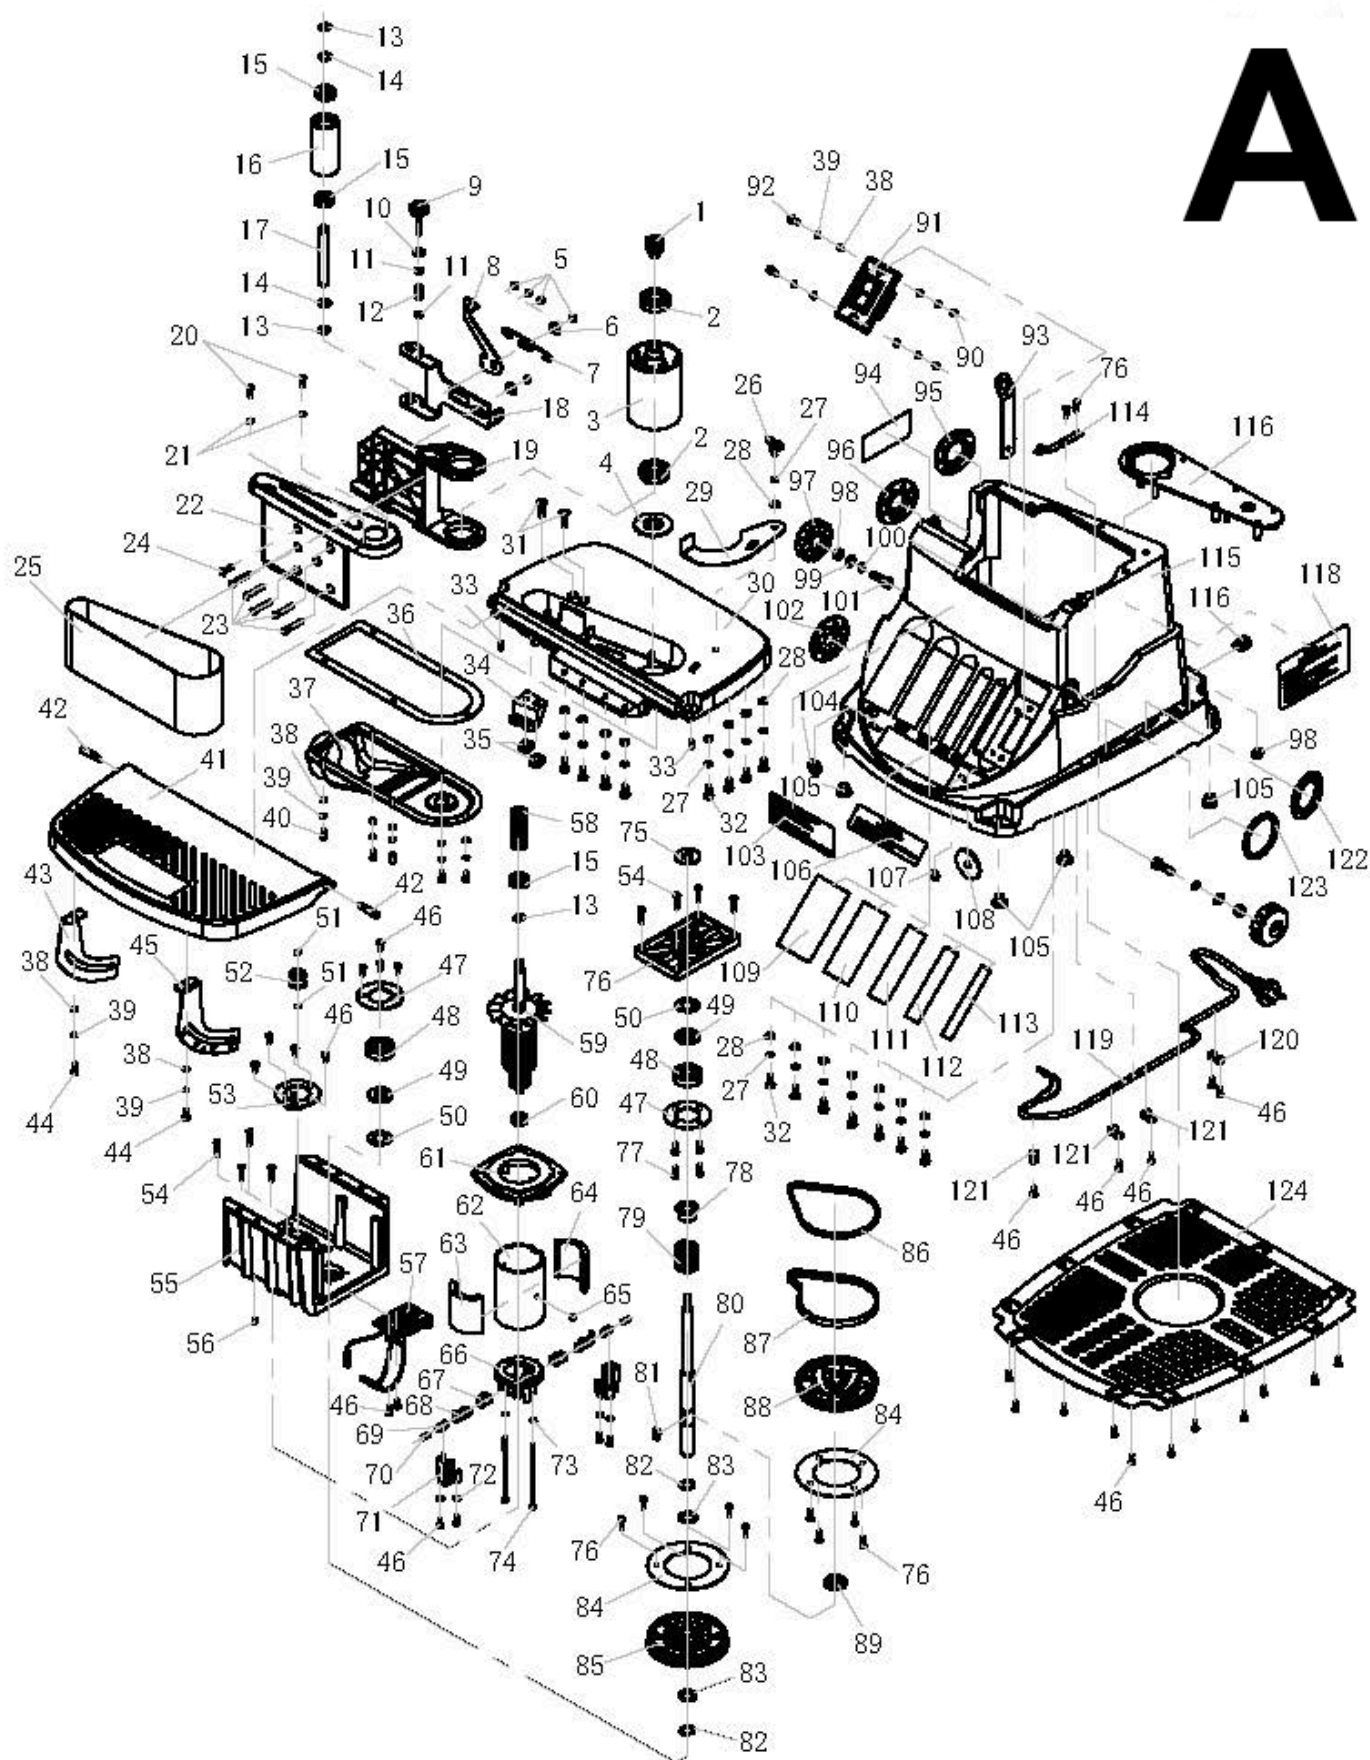



5903405901

oscillating edge-, belt-
and spindle sander
OSM600 scheppach
(DIY)



Main products

Spare part list

5903405901

136114 - 0111 - osm600 - 0111 - -

Spare	Description	additional	Item	Abb.	Construct	Status
5903405014	knob	M8 / Ø12 x 13mm	1	A	Anweisung A mit B	
5903405001	Sanding Belt Wheel cpl. Part 1 -24		1-25	A	*	
02012508	washer	A13 ST 125 VZ	2	A	*	
5903405016	Connector		4	A	*	
02093403	Hexagon nut	M5	5	A	*	
3901601050	fixing screw	M5x38	9	A	*	
02012504	washer	A6	10	A	*	
02012503	washer	A5	11	A	*	
5910803014	spring for line spool		12	A	*	
01047109	circlip ring	A 12x1,0 FEDST 471 BK	13	A	*	
5903405021	Motor cpl.	230V/50Hz 450W - osm600	13,15,46-89	A	*	
7903400705	grinding belt OSM600 scheppach (DIY)	610x100 (Satz = 9 Stück) K 80/100/120	25	A	*	
02012504	washer	A6	26	A	D (3)	
02012705	spring washer	A6	26	A	D (2)	
05006438	wing knob	M6x12 P 211 30 1 PELTZER	26	A	D (1)	
5903405019	auxiliary baffle assy.		26 - 29	A	*	
02012705	spring washer	A6	27	A	*	
02012504	washer	A6	28	A	*	
5903405015	locking sanding belt attachment		34	A	*	
3903401023	gasket		36	A	*	not available anymore
3903401024	dust cover		37	A	*	
02012503	washer	A5	38	A	*	
3902202133	spring washer	A5, form A, galvanised, DIN127	39	A	*	
5903405020	Flexible aluminum work bench		41	A	*	
06206203	ball bearing	6203-Z Ø40xØ17x12	48	A	*	



5903405901

oscillating edge-, belt-
and spindle sander
OSM600 scheppach
(DIY)



Main products

Spare part list

5903405901

136114 - 0111 - osm600 - 0111 - -

Spare	Description	additional	Item	Abb.	ConstructStatus
3903401040	tension roller cpl. with bearing	Ø23x18	52	A	*
3903401082	circuit board part 69	TNS-2TH X2 / 0.22uF / 25/085/21/C / AC250V	57	A	*
5903405002	Motor cpl.	Ø88x230	58-60,15,13	A	*
3908203022	bearing part 49	2-RS Ø22xØ8x7	60	A	*
5903405003	Carbon Brush with Holder (1Set=2Pcs.) Part 67-70 (1Satz=2Stück)		67-70	A	*
02012502	washer	Ø4 / DIN125	73	A	*
01047114	circlip ring	A 17x1,0 FEDST 471 BK	82	A	*
3903401079	drive wheel	Ø17 / Ø115	85	A	*
3903401036	upper drive belt	160XL 11x2,5	86	A	*
3903401037	lower drive belt	160XL x 6x2,5	87	A	*
3903401076	drive wheel	Ø115x25	88	A	*
02093403	Hexagon nut	M5	90	A	*
3903401011	switch	CK-1 6(4)A 250V	91	A	*
1902501033	Switch part 33	6(4) A / 230V / DK-1	91-1	A	ohne Rahmen
5903405013	Table Insert Set (Ø19/26/38/51) Part 95+96+102+122+123	Ø13/19/26/38/51	95	A	*
5903405013	Table Insert Set (Ø19/26/38/51) Part 95+96+102+122+123	Ø13/19/26/38/51	95+96+102+122+123	A	*
5903405013	Table Insert Set (Ø19/26/38/51) Part 95+96+102+122+123	Ø13/19/26/38/51	96	A	*
5903405018	knob	M8	97	A	*
02093403	Hexagon nut	M5	98	A	*
02012506	washer	A8 - Ø8,4 / Ø16 x 1.6, Form A, verzinkt. DIN125	99	A	*
02091248	cheese head screw	M8x25 8.8 912 VZ	101	A	*
5903405013	Table Insert Set (Ø19/26/38/51) Part 95+96+102+122+123	Ø13/19/26/38/51	102	A	*
3903401026	rubber foot		105	A	*
7903400702	sanding sleeve	(Satz = 3 Stück)	109	A	*
7903400703	sanding sleeve	(Satz = 3 Stück)	109	A	*



5903405901

oscillating edge-, belt-
and spindle sander
OSM600 scheppach
(DIY)



Main products

Spare part list

5903405901 136114 - 0111 - osm600 - 0111 - -

Spare	Description	additional	Item	Abb.	ConstructStatus
7903400701	sanding sleeve	(Satz = 3 Stück)	110	A	*
7903400702	sanding sleeve	(Satz = 3 Stück)	111	A	
7903400703	sanding sleeve	(Satz = 3 Stück)	111	A	*
7903400703	sanding sleeve	(Satz = 3 Stück)	112	A	*
7903400702	sanding sleeve	(Satz = 3 Stück)	112	A	*
7903400702	sanding sleeve	(Satz = 3 Stück)	113	A	direkt auf Spindel mont.
7903400701	sanding sleeve	(Satz = 3 Stück)	113	A	*
5903405007	Plastic Base Part 115		115	A	*
5903405008	Plastic Panel		116	A	*
5903405009	Power Cord with EU-Plug Part 119	H05VV-F 3GOx0.75mm² x 2m	119	A	*
5903405013	Table Insert Set (Ø19/26/38/51) Part 95+96+102+122+123	Ø13/19/26/38/51	122	A	*
5903405013	Table Insert Set (Ø19/26/38/51) Part 95+96+102+122+123	Ø13/19/26/38/51	123	A	*
5903405012	Plastic Bottom Plate Part 124		124	A	*
7903400705	grinding belt OSM600 scheppach (DIY)	610x100 (Satz = 9 Stück) K 80/100/120	o.Abb	A	*
7903400701	sanding sleeve	(Satz = 3 Stück)	o.Abb	A	*
3903401117	rubber roller set 1set 5pcs. Ø19.26.38.51.76	Ø19.26.38.51.76	o.Abb	A	*
3903401712	sanding sleeve	3-teilig	o.Abb	A	*
3903401111	rubber roller	Ø 19 mm	o.Abb	A	*
3903401112	rubber roller Ø 26 mm part 4	Øi. 13	o.Abb	A	*
3903401113	rubber roller Ø 38 mm part 4	Øi. 13	o.Abb	A	*
3903401114	rubber roller Ø 51 mm part 4	Øi. 13	o.Abb	A	*
3903401115	rubber roller Ø 76 mm part 4	Ø76x114,5	o.Abb.	A	*
3903401111	rubber roller	Ø 19 mm	o.Abb.	A	*
02093405	hexagon nut M8	M8, verzinkt, DIN934	o.Abb.	A	Spindelmutter (E)
5903405017	spindle washer set	Ø16/22/44 (1set=3pcs.)	o.Abb.	A	Anweisung (D)



5903405901

oscillating edge-, belt-
and spindle sander
OSM600 scheppach
(DIY)



!!! Do you know: From now on you can view spare parts lists in our spare parts shop and order spare parts and accessories directly. More information can be found here: <https://www.scheppach.com/Shop.aspx>